




Normal: L
Standby: H

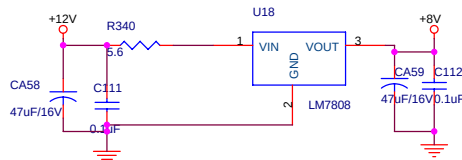




2.5V for MST9X88L and
DDRAM

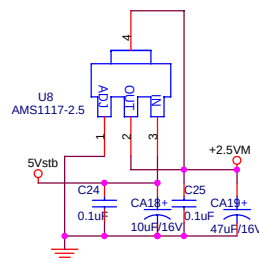

2.5V for DDRAM

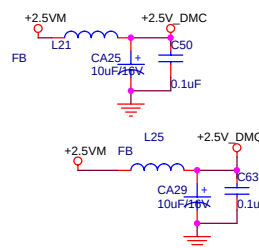


+2.5V for MST5151LA

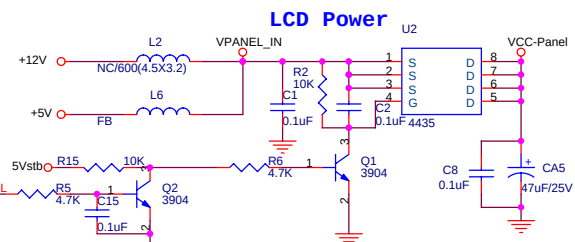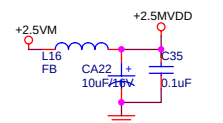


LG-PHILIPS LC320W
Other

R10=NC, R12=10K;
R10=10K, R12=NC;

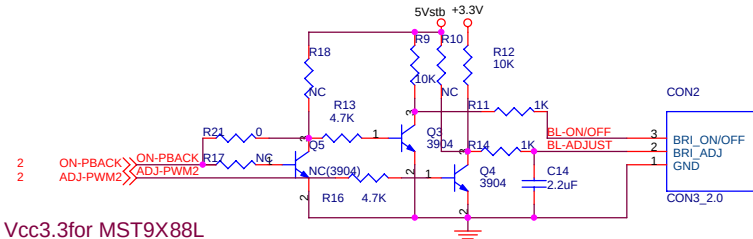



Vcc3.3for MST9X88L
Digital

$$1.25 \cdot (1 + R_{\text{down}}/R_{\text{up}}) = 3.3\text{V} \text{---} R_{\text{up}} = 510, R_{\text{down}} = 820$$

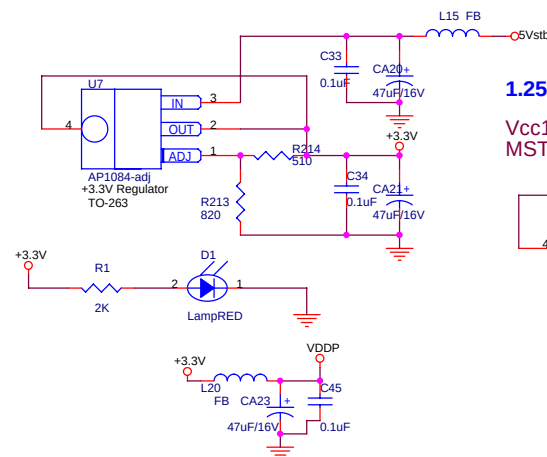


$$1.25 \cdot (1 + R_{\text{down}}/R_{\text{up}}) = 1.8\text{V} \text{---} R_{\text{up}} = 1.2\text{K}, R_{\text{down}} = 510$$

Vcc1.8 for
MST5151LA

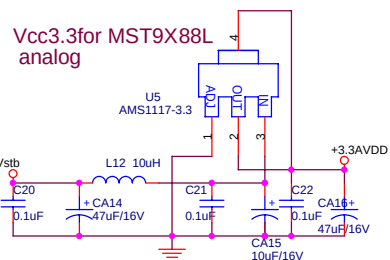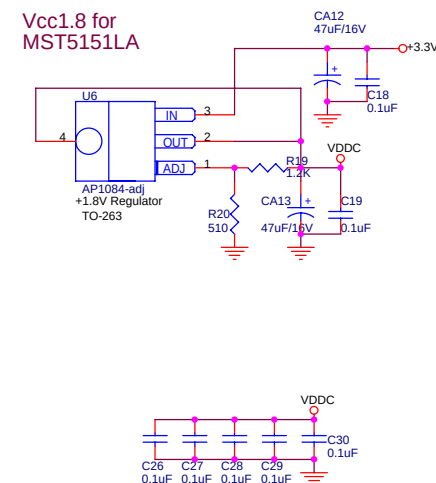


Vcc3.3f
analog

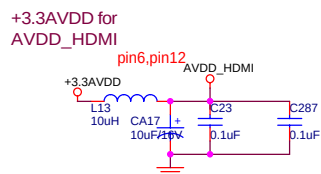


+3.3AVDD for
AVDD HDMI


3
uH CA17 +

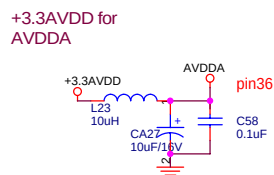


+3.3AVDD for
AVDDA

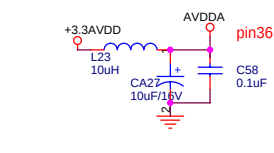

+3.3AVDD

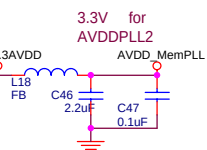
+3.3AVDD  pin36

3.3V for AVDDPLL2

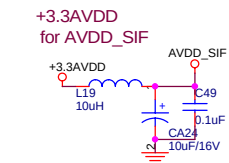

+3.3AVDD
for AVDD_SIF

for AVDD_SIF

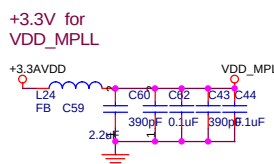



+3.3V for
VDD MPLL


VDD MPLL





HOUDA MST9X88L

Size A3	Document Number POWER	Rev <RevCode>
Date:	Friday, December 15, 2006	Sheet 1 of 11

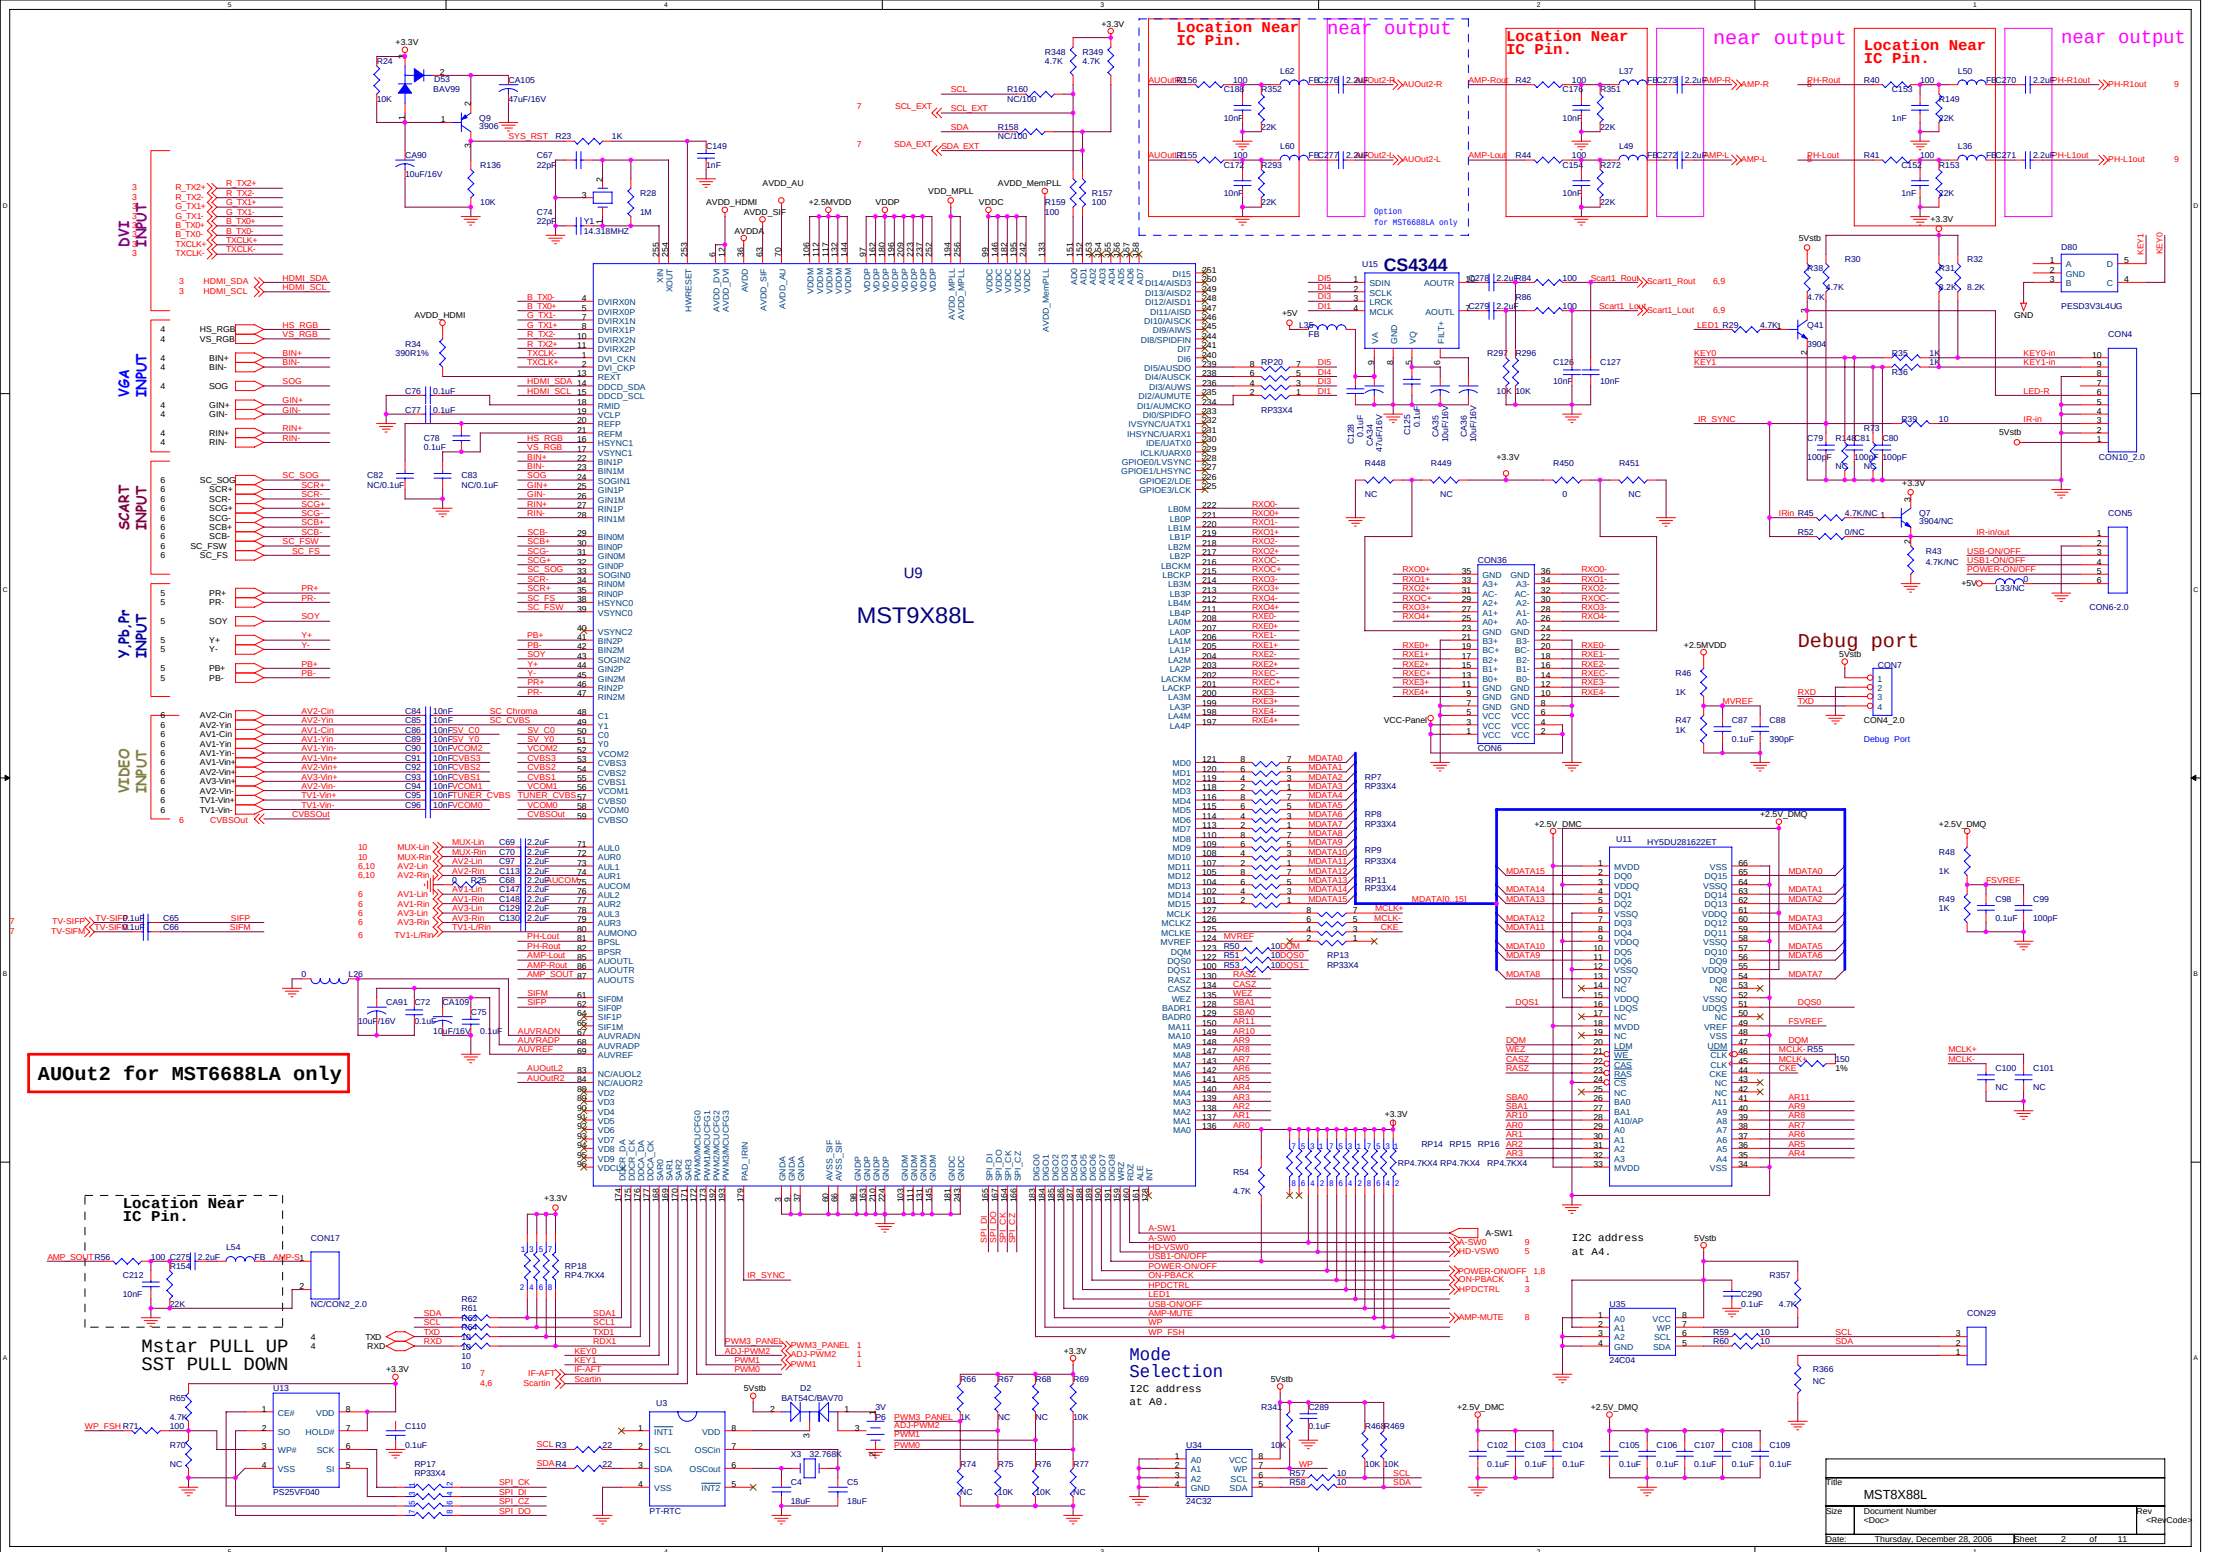

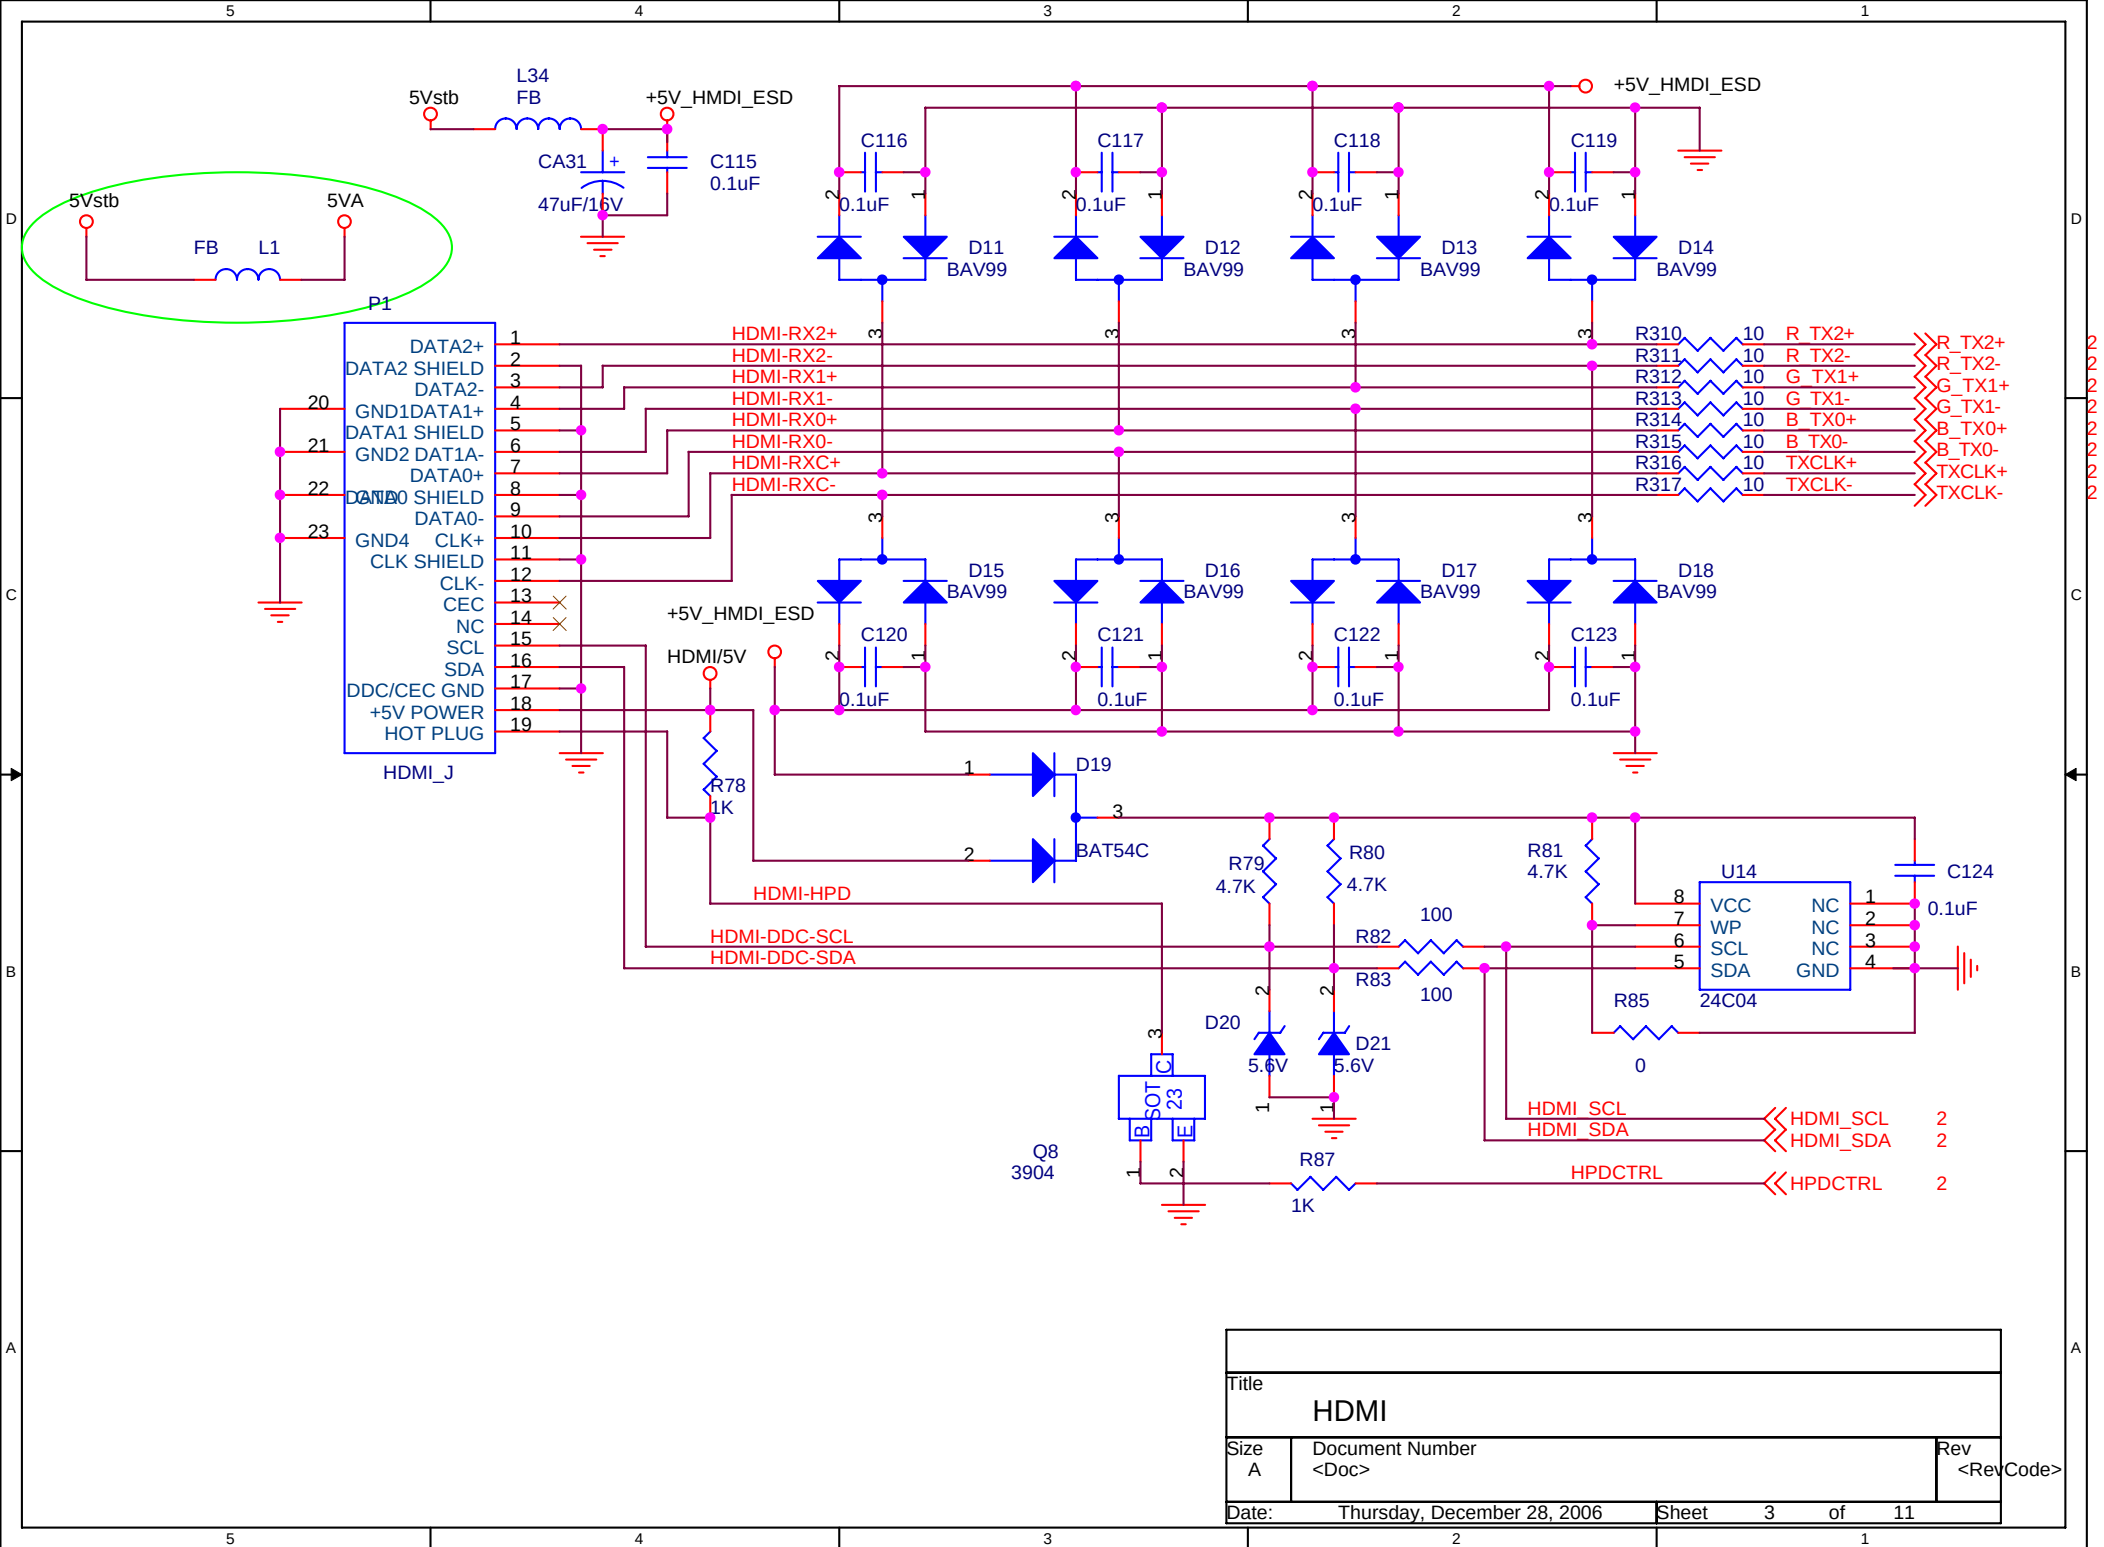


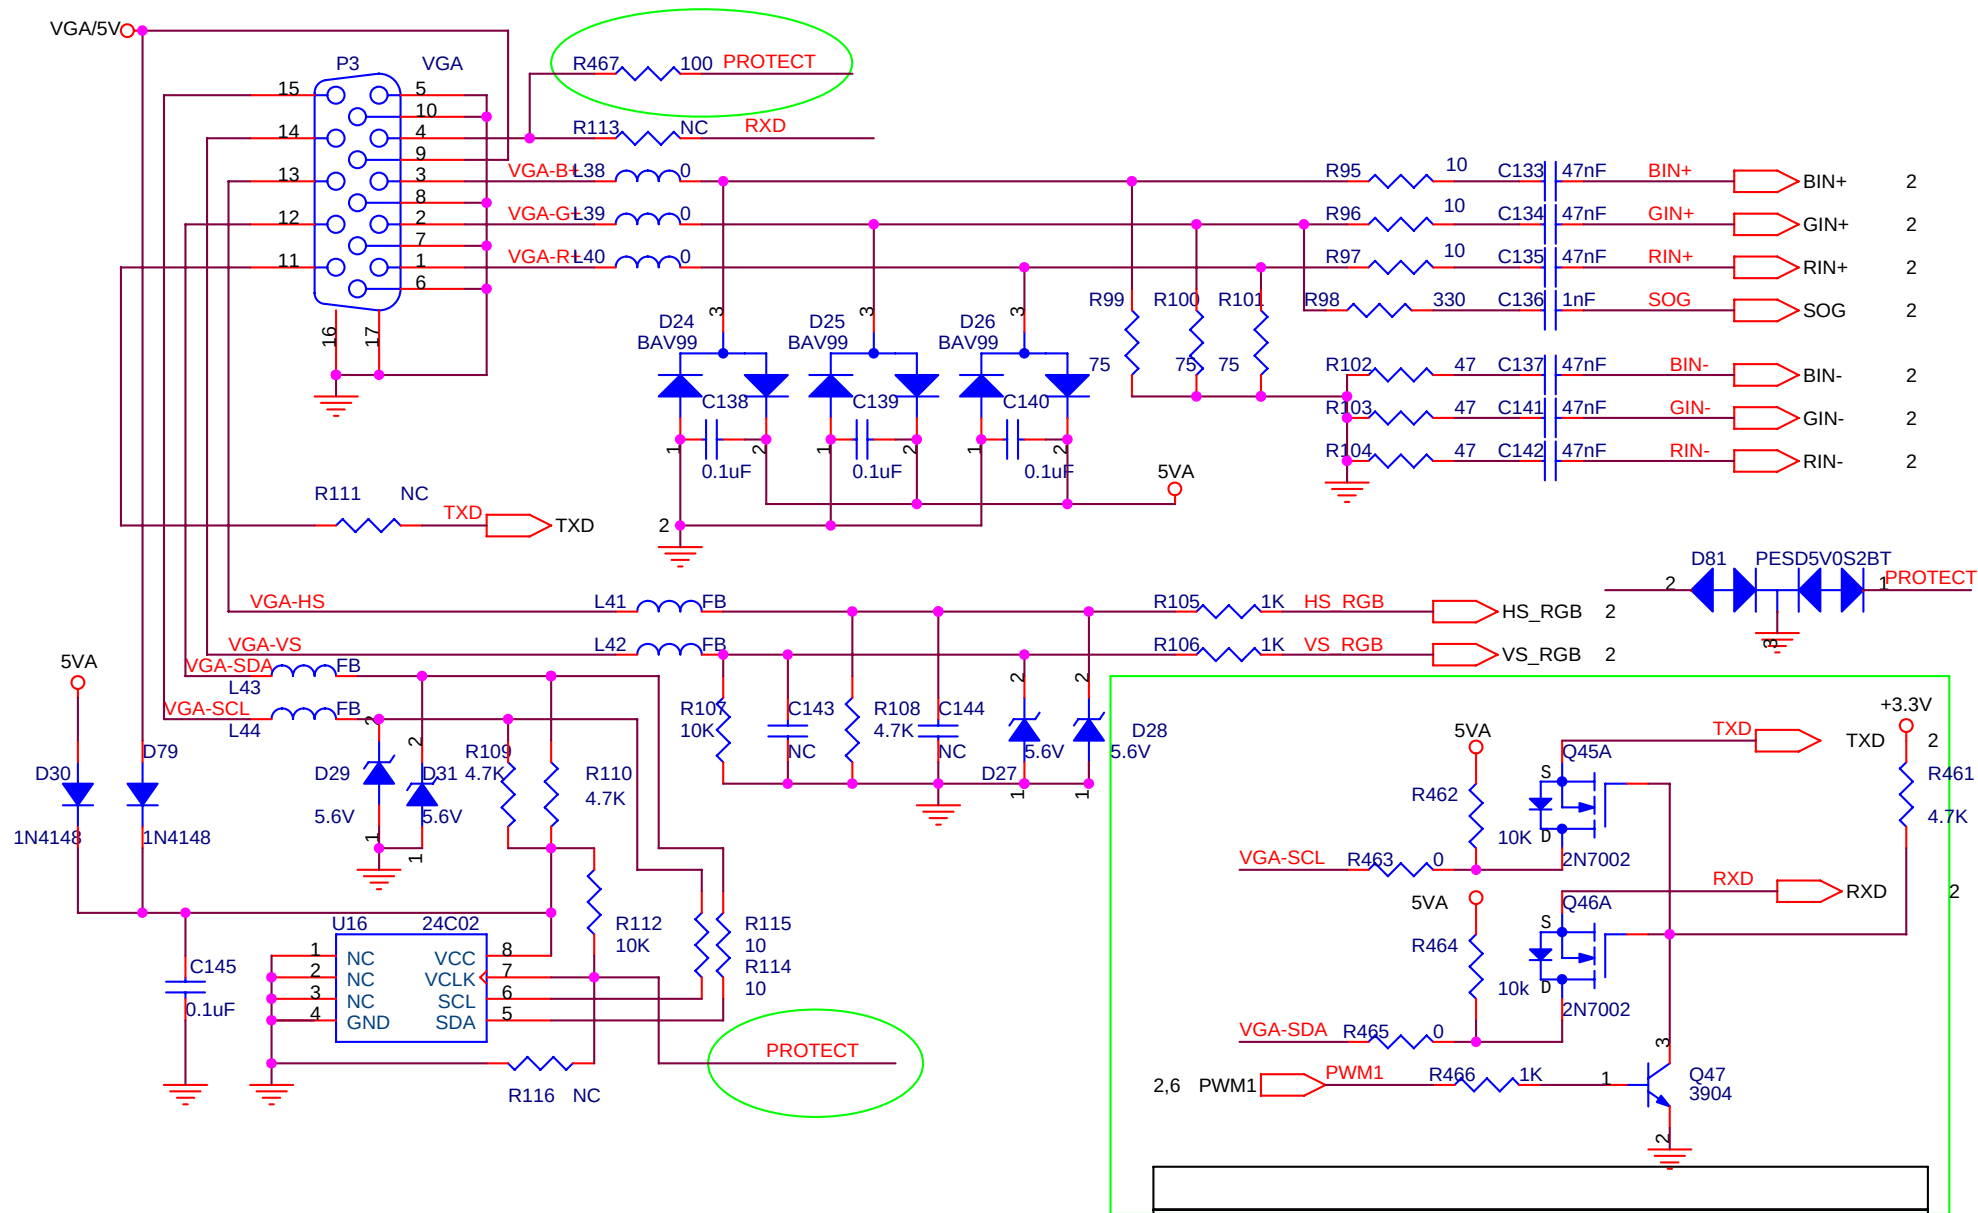


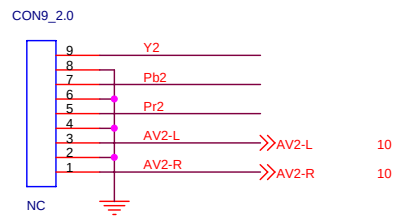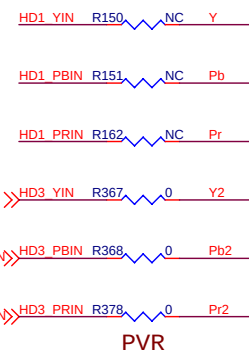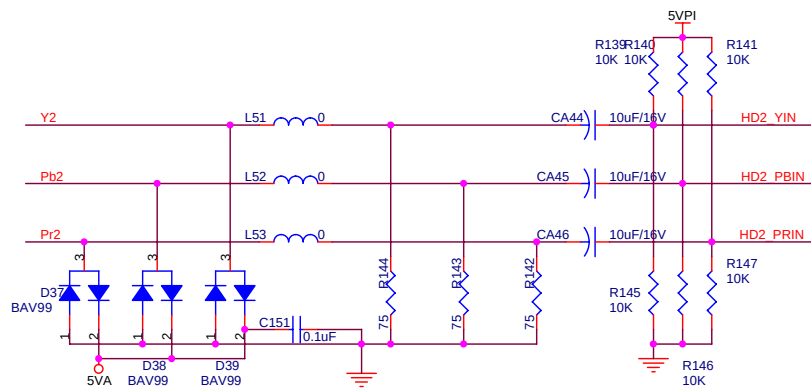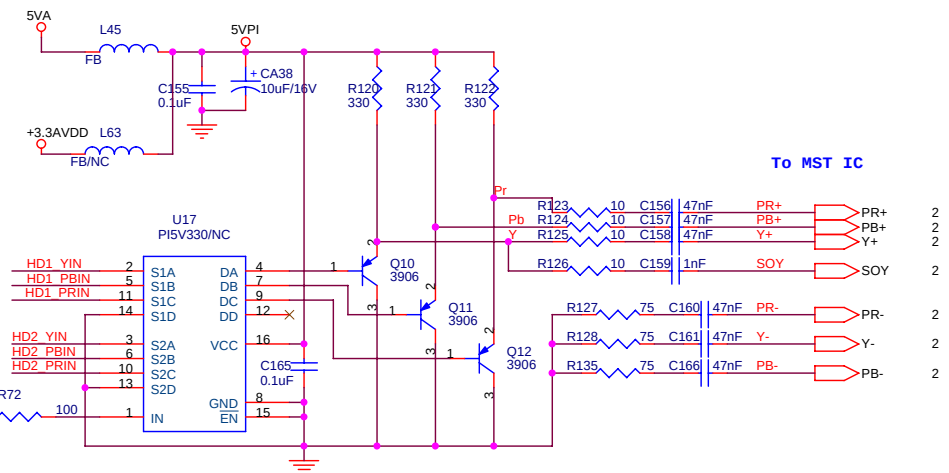


Title		
HD INPUT		
Size B	Document Number <Doc>	Rev <RevCode>
Date:	Friday, December 15, 2006	Sheet 5 of 11


```
I2C ADDRESS(R263 NC):READ is 0X87
WRITE is 0X86
```




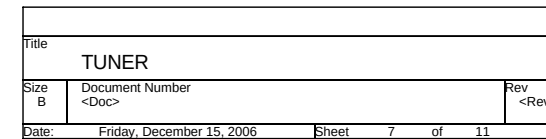


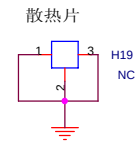



Near MST9688L PIN

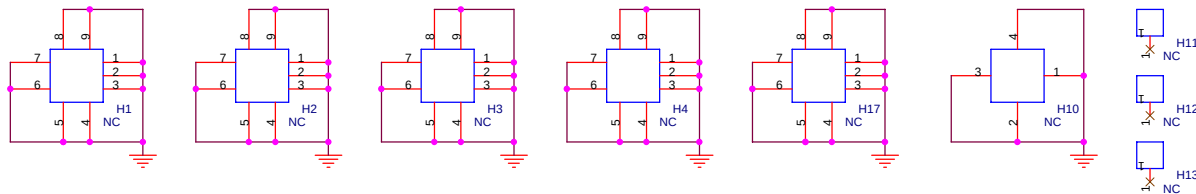


Title			
TDA7266			
Size A3	Document Number <Doc>	Rev <Rev>	Code
Date:	Friday, December 15, 2006	Sheet	8 of 11

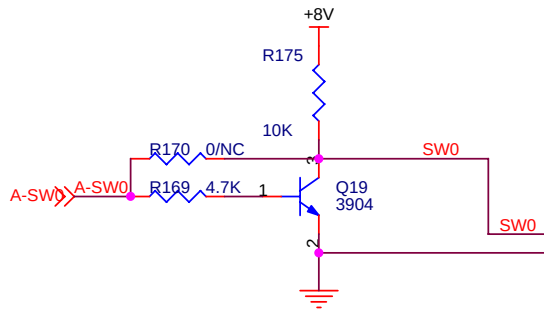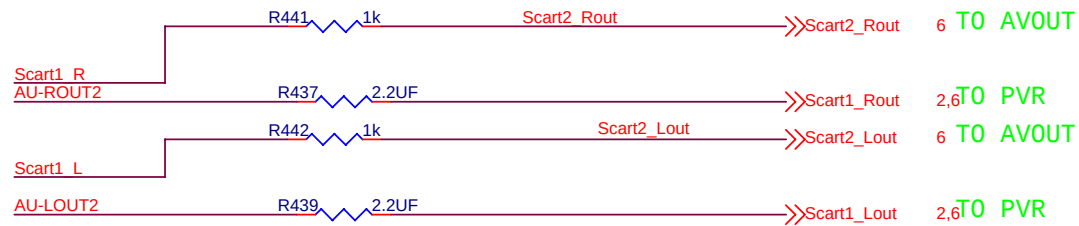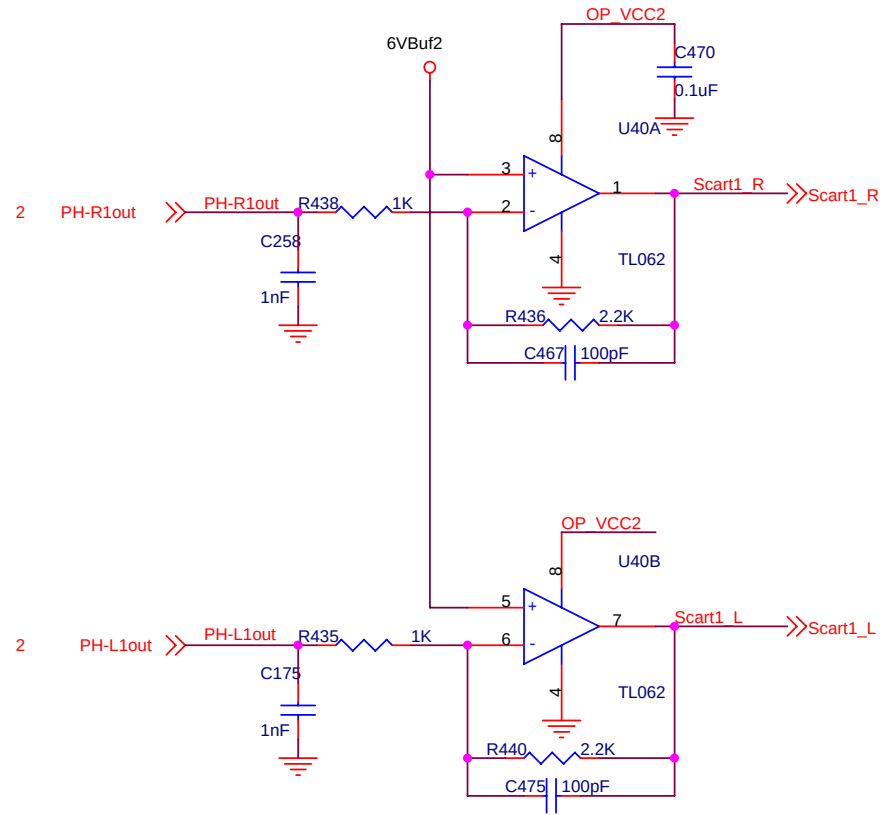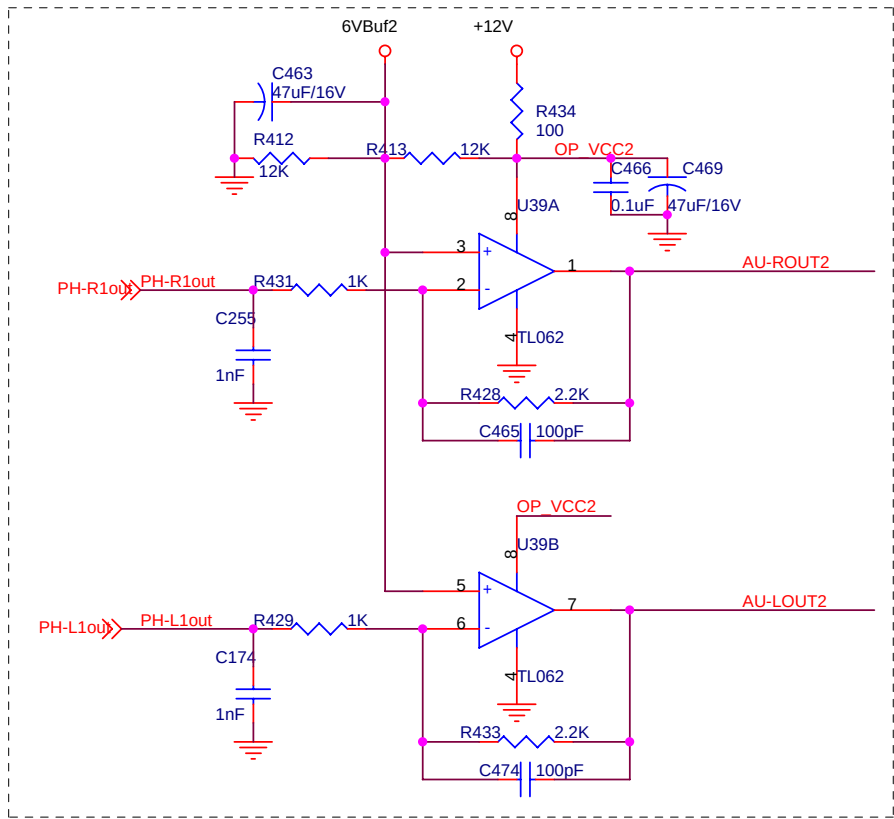

Title		
AUDIO AMP		
Size A4	Document Number MST9X88L	Rev 100
Date:	Friday, December 15, 2006	Sheet 9 of 11

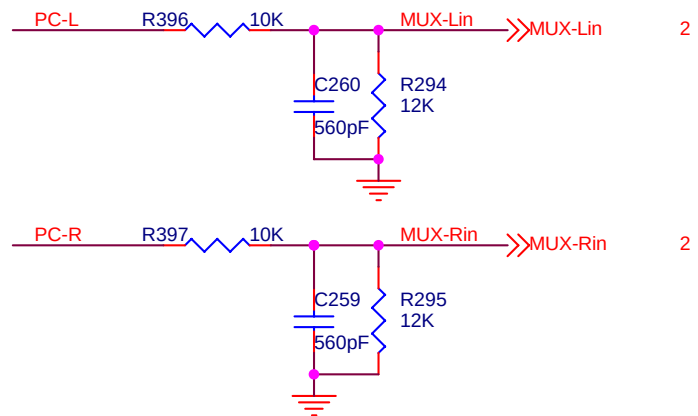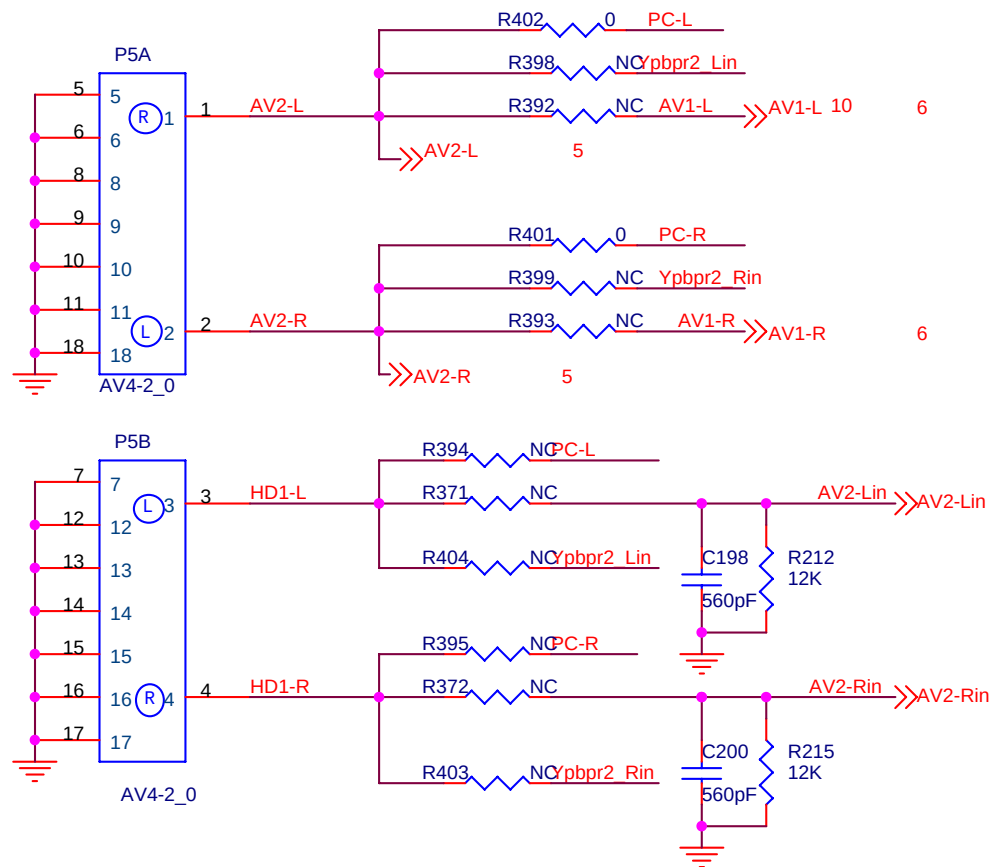

AV AUDIO Input			
Title AUDIO INPUT			
Size A	Document Number <Doc>		Rev <RevCode>
Date:	Friday, December 15, 2006	Sheet	10 of 11

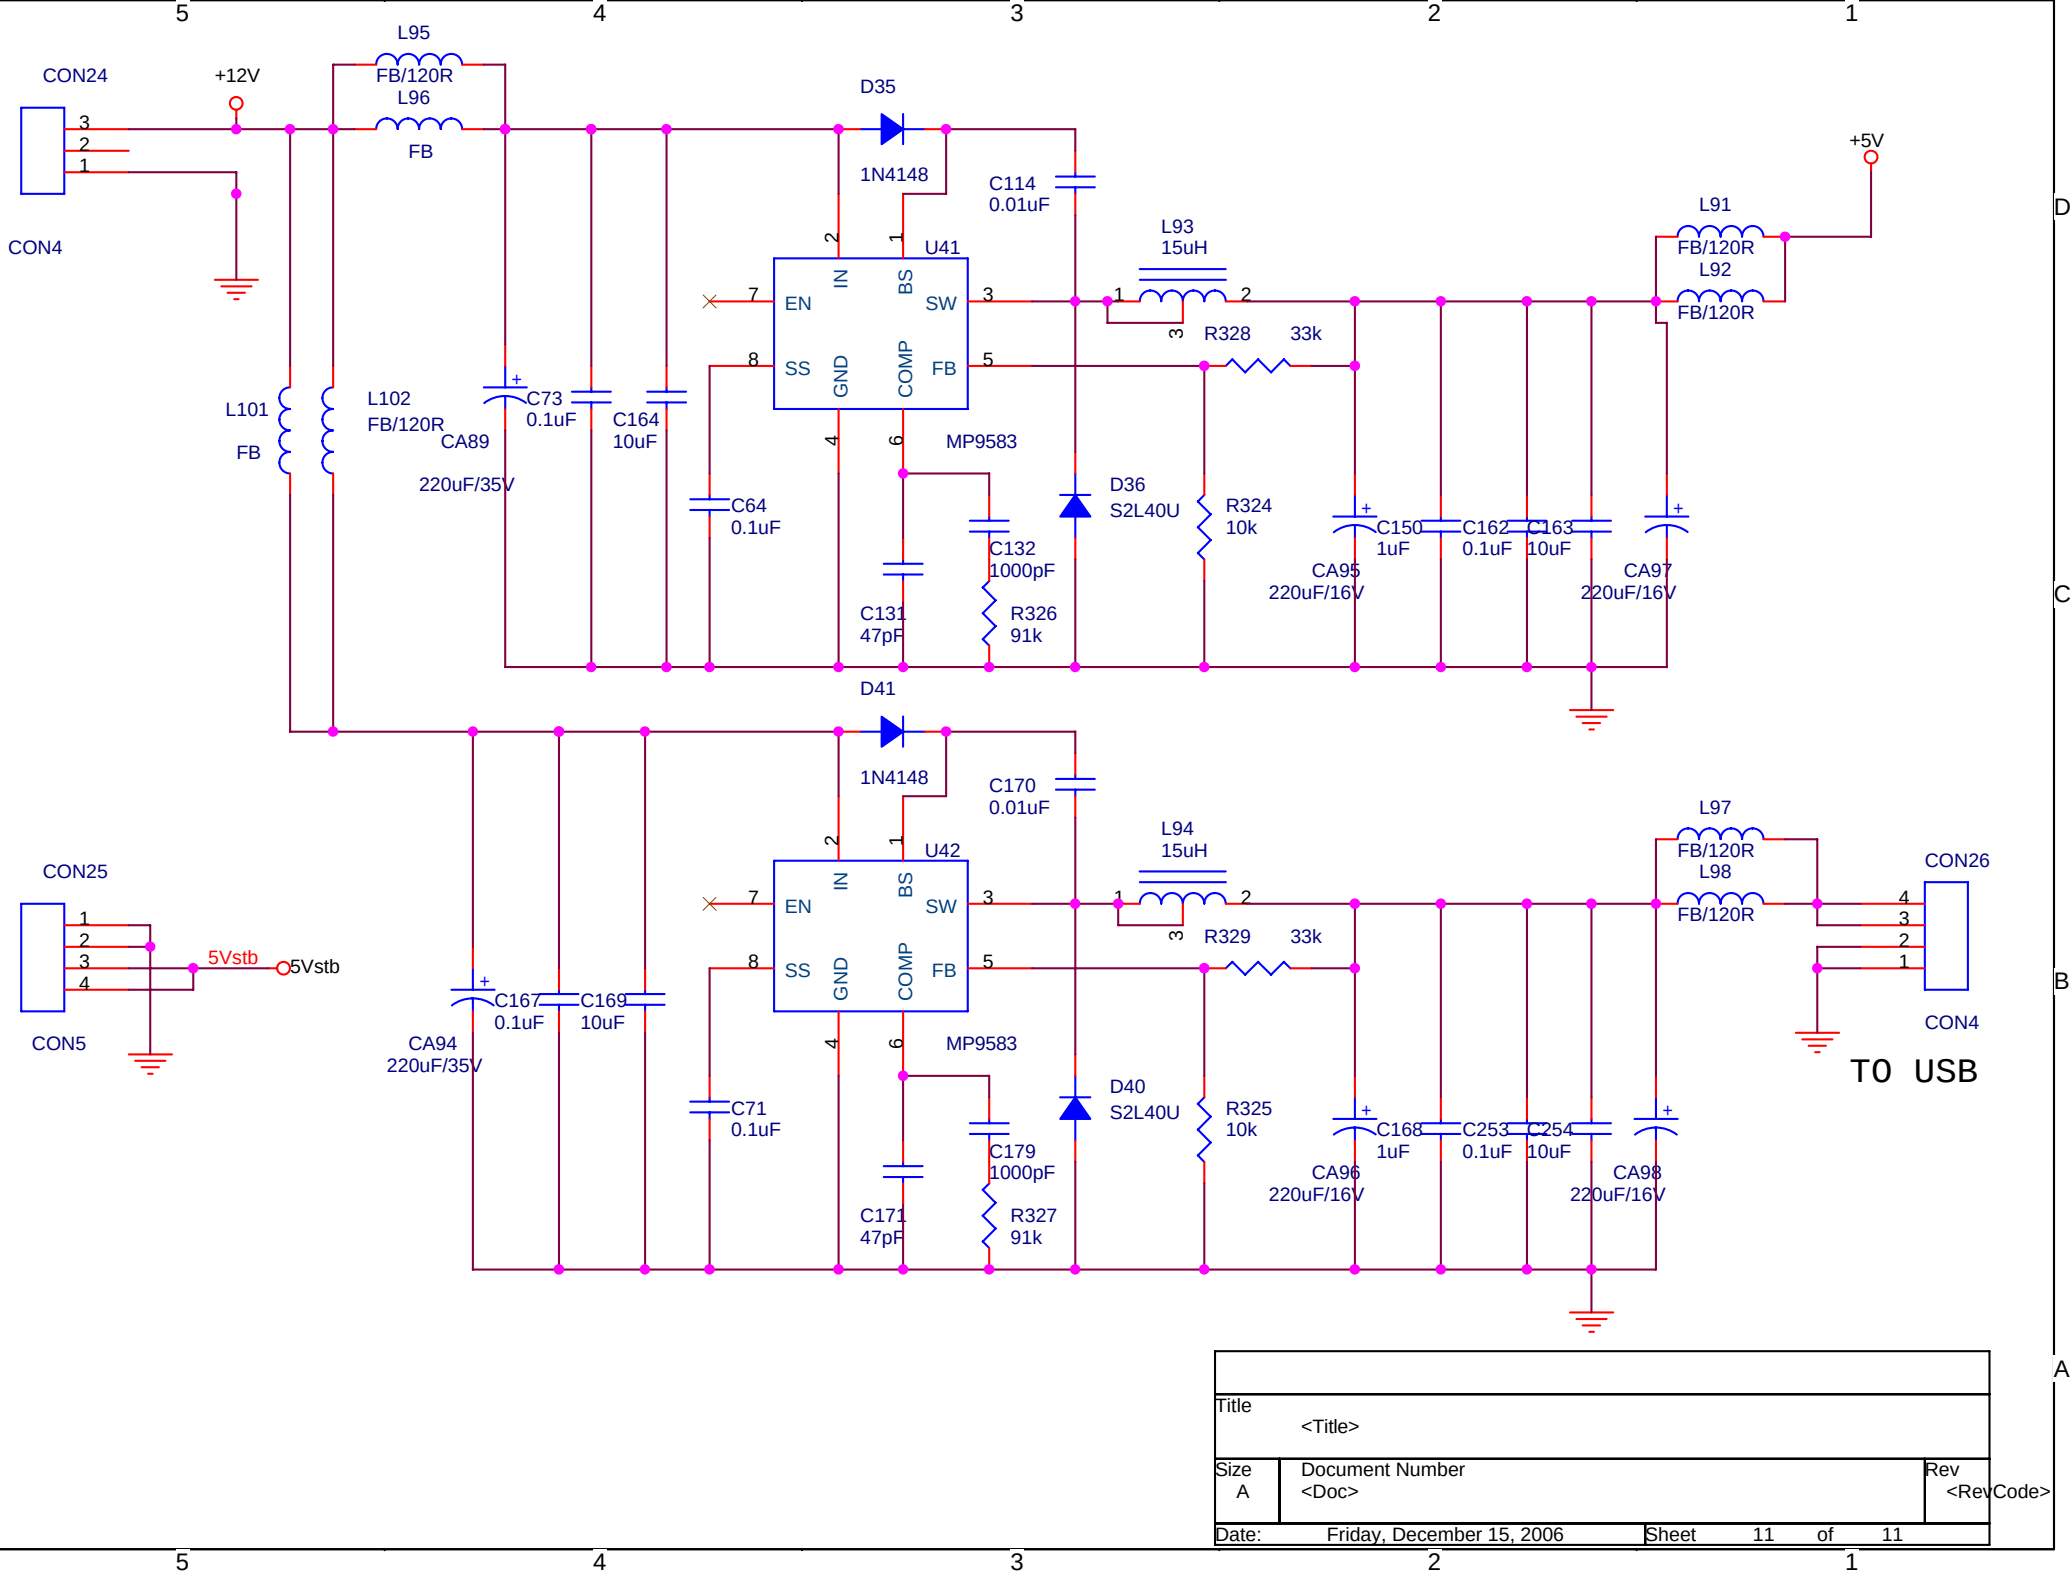

Title		
<Title>		
Size	Document Number	Rev
A	<Doc>	<RevCode>
Date:	Friday, December 15, 2006	Sheet 11 of 11